


中压外螺纹转NPT外螺纹

Medium Pressure Male Thread to Male NPT

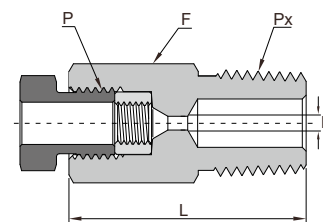

P 中压接头	Px NPT	产品编号 Product No.	尺寸数据 in.(mm)			工作压力 Psig(bar)
			L	D	F (六角)	
1/4	1/8	-MTM-M04-MN2	1.19 (30.2)	0.11 (2.8)	0.63 (15.9)	15000 (1034)
1/4	1/4	-MTM-M04-MN4	1.37 (34.9)	0.11 (2.8)	0.63 (15.9)	15000 (1034)
1/4	3/8	-MTM-M04-MN6	1.37 (34.9)	0.11 (2.8)	0.69 (17.5)	15000 (1034)
1/4	1/2	-MTM-M04-MN8	1.37 (34.9)	0.11 (2.8)	0.87 (22.2)	15000 (1034)
3/8	1/8	-MTM-M06-MN2	1.37 (34.9)	0.20 (5.1)	0.75 (19.1)	15000 (1034)
3/8	1/4	-MTM-M06-MN4	1.50 (38.1)	0.20 (5.1)	0.75 (19.1)	15000 (1034)
3/8	3/8	-MTM-M06-MN6	1.50 (38.1)	0.20 (5.1)	0.75 (19.1)	15000 (1034)
3/8	1/2	-MTM-M06-MN8	1.75 (44.5)	0.20 (5.1)	0.87 (22.2)	15000 (1034)
3/8	3/4	-MTM-M06-MN12	2.00 (50.8)	0.20 (5.1)	1.06 (27.0)	10000 (690)
9/16	1/4	-MTM-M09-MN4	1.75 (44.5)	0.25 (6.4)	1.00 (25.4)	15000 (1034)
9/16	3/8	-MTM-M09-MN6	1.75 (44.5)	0.31 (7.9)	1.00 (25.4)	15000 (1034)
9/16	1/2	-MTM-M09-MN8	1.94 (49.2)	0.31 (7.9)	1.00 (25.4)	15000 (1034)
9/16	3/4	-MTM-M09-MN12	2.00 (50.8)	0.31 (7.9)	1.06 (27.0)	10000 (690)
9/16	1	-MTM-M09-MN16	2.25 (57.2)	0.31 (7.9)	1.38 (34.9)	10000 (690)
3/4	1/4	-MTM-M12-MN4	2.00 (50.8)	0.25 (6.4)	1.38 (34.9)	15000 (1034)
3/4	3/8	-MTM-M12-MN6	2.00 (50.8)	0.31 (7.9)	1.38 (34.9)	15000 (1034)
3/4	1/2	-MTM-M12-MN8	2.19 (55.6)	0.38 (9.6)	1.38 (34.9)	15000 (1034)
3/4	3/4	-MTM-M12-MN12	2.25 (57.2)	0.44 (11.1)	1.38 (34.9)	10000 (690)
3/4	1	-MTM-M12-MN16	2.63 (66.7)	0.44 (11.1)	1.38 (34.9)	10000 (690)
1	1/4	-MTM-M16-MN4	2.87 (73.0)	0.25 (6.4)	1.75 (44.5)	15000 (1034)
1	3/8	-MTM-M16-MN6	2.87 (73.0)	0.31 (7.9)	1.75 (44.5)	15000 (1034)
1	1/2	-MTM-M16-MN8	2.87 (73.0)	0.38 (9.6)	1.75 (44.5)	15000 (1034)
1	3/4	-MTM-M16-MN12	2.87 (73.0)	0.56 (14.3)	1.75 (44.5)	10000 (690)
1	1	-MTM-M16-MN16	3.06 (77.8)	0.56 (14.3)	1.75 (44.5)	10000 (690)