


高压内螺纹转高压锥管


Female High Pressure to High Series
Coned and Threaded Nipples

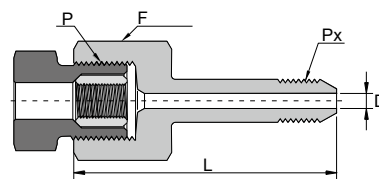

P 高压接头	Px 高压锥管	产品编号 Product No.	尺寸数据 in.(mm)			工作压力 Psig(bar)
			L	D	F (六角)	
1/4	1/4	-HFM-H04-HC04	1.93 (49.0)	0.09 (2.3)	0.75 (19.1)	60000 (4137)
1/4	3/8	-HFM-H04-HC06	2.32 (59.0)	0.09 (2.3)	0.75 (19.1)	60000 (4137)
1/4	9/16	-HFM-H04-HC09	2.91 (74.0)	0.09 (2.3)	0.75 (19.1)	60000 (4137)
3/8	1/4	-HFM-H06-HC04	2.20 (56.0)	0.09 (2.3)	1.00 (25.4)	60000 (4137)
3/8	3/8	-HFM-H06-HC06	2.60 (66.0)	0.13 (3.2)	1.00 (25.4)	60000 (4137)
3/8	9/16	-HFM-H06-HC09	3.19 (81.0)	0.13 (3.2)	1.00 (25.4)	60000 (4137)
9/16	1/4	-HFM-H09-HC04	2.48 (63.0)	0.09 (2.3)	1.38 (34.9)	60000 (4137)
9/16	3/8	-HFM-H09-HC06	2.87 (73.0)	0.13 (3.2)	1.38 (34.9)	60000 (4137)
9/16	9/16	-HFM-H09-HC09	3.46 (88.0)	0.19 (4.8)	1.38 (34.9)	60000 (4137)

高压内螺纹转60°内锥外螺纹

Female High Pressure to Male Type "M"

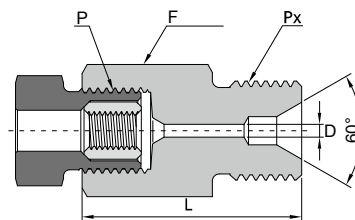

P 高压接头	Px UNF	产品编号 Product No.	尺寸数据 in.(mm)			工作压力 Psig(bar)
			L	D	F (六角)	
1/4	9/16-18	-HFM-H04-MS9	1.25 (31.8)	0.09 (2.3)	0.75 (19.1)	60000 (4137)
1/4	3/4-16	-HFM-H04-MS12	1.38 (35.0)	0.09 (2.3)	0.75 (19.1)	30000 (2058)
1/4	7/8-14	-HFM-H04-MS14	1.56 (39.7)	0.09 (2.3)	1.00 (25.4)	50000 (3447)
1/4	1-12	-HFM-H04-MS16	1.37 (34.9)	0.09 (2.3)	1.00 (25.4)	30000 (2058)
3/8	9/16-18	-HFM-H06-MS9	1.50 (38.1)	0.09 (2.3)	1.00 (25.4)	60000 (4137)
3/8	3/4-16	-HFM-H06-MS12	1.63 (41.4)	0.13 (3.2)	1.00 (25.4)	30000 (2058)
3/8	7/8-14	-HFM-H06-MS14	1.81 (46.0)	0.13 (3.2)	1.00 (25.4)	50000 (3447)
3/8	1-12	-HFM-H06-MS16	1.64 (41.6)	0.13 (3.2)	1.00 (25.4)	30000 (2058)
3/8	1.5/16-12	-HFM-H06-MS21	1.56 (39.7)	0.13 (3.2)	1.38 (34.9)	20000 (1379)
9/16	7/8-14	-HFM-H09-MS14	2.00 (50.8)	0.15 (3.8)	1.38 (34.9)	50000 (3447)
9/16	1-12	-HFM-M09-MS16	1.81 (46.0)	0.19 (4.8)	1.38 (34.9)	30000 (2058)
9/16	1.5/16-12	-HFM-M09-MS21	1.81 (46.0)	0.19 (4.8)	1.38 (34.9)	20000 (1379)