


中压外螺纹转JIC外螺纹

Male Medium Pressure to Male JIC

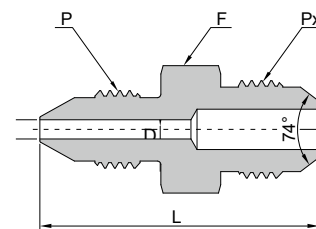

P 中压-外	Px JIC	产品编号 Product No.	尺寸数据 in.(mm)			工作压力 Psig(bar)
			L	D	F (六角)	
1/4	1/4	-MNM-M04-AN9	1.50 (38.1)	0.11 (2.8)	0.50 (12.7)	20000 (1379)
1/4	3/8	-MNM-M04-AN12	1.63 (41.3)	0.11 (2.8)	0.63 (15.9)	20000 (1379)
1/4	1/2	-MNM-M04-AN14	1.75 (44.5)	0.11 (2.8)	0.81 (20.6)	20000 (1379)
3/8	1/4	-MNM-M06-MS9	1.75 (44.5)	0.17 (4.4)	0.63 (15.9)	20000 (1379)
3/8	3/8	-MNM-M06-MS12	1.75 (44.5)	0.20 (5.1)	0.63 (15.9)	20000 (1379)
3/8	1/2	-MNM-M06-MS14	1.87 (47.6)	0.20 (5.1)	0.81 (20.6)	20000 (1379)
3/8	5/8	-MNM-M06-MS16	2.06 (52.4)	0.20 (5.1)	0.94 (23.8)	20000 (1379)
9/16	1/4	-MNM-M09-MS9	2.00 (50.8)	0.17 (4.4)	0.94 (23.8)	20000 (1379)
9/16	3/8	-MNM-M09-MS12	2.01 (51.0)	0.23 (5.8)	0.94 (23.8)	20000 (1379)
9/16	1/2	-MNM-M09-MS14	2.13 (54.0)	0.31 (7.9)	0.94 (23.8)	20000 (1379)
9/16	5/8	-MNM-M09-MS16	2.25 (57.2)	0.31 (7.9)	0.94 (23.8)	20000 (1379)
9/16	3/4	-MNM-M09-MS16	2.44 (61.9)	0.31 (7.9)	1.13 (28.6)	15000 (1034)
3/4	1/2	-MNM-M12-MS9	2.37 (60.3)	0.31 (7.9)	1.19 (30.2)	20000 (1379)
3/4	5/8	-MNM-M12-MS12	2.50 (63.5)	0.37 (9.4)	1.19 (30.2)	20000 (1379)
3/4	3/4	-MNM-M12-MS14	2.63 (66.7)	0.44 (11.1)	1.19 (30.2)	15000 (1034)
3/4	1	-MNM-M12-MS16	2.69 (68.3)	0.44 (11.1)	1.19 (30.2)	15000 (1034)
1	3/4	-MNM-M16-MS9	3.13 (79.4)	0.46 (11.6)	1.50 (38.1)	15000 (1034)
1	1	-MNM-M16-MS12	3.19 (81.0)	0.56 (14.3)	1.50 (38.1)	15000 (1034)