


中压内螺纹转高压外螺纹

Female Medium Pressure to Male Medium Pressure

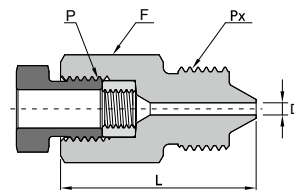

P 中压-内	Px 高压-外	产品编号 Product No.	尺寸数据 in.(mm)			工作压力 Psig(bar)
			L	D	F (六角)	
1/4	1/4	-MTM-M04-H04	1.31 (33.3)	0.09 (2.3)	0.63 (15.9)	20000 (1379)
1/4	3/8	-MTM-M04-H06	1.50 (38.1)	0.11 (2.8)	0.81 (20.6)	20000 (1379)
1/4	9/16	-MTM-M04-H09	1.63 (41.3)	0.11 (2.8)	1.19 (30.2)	20000 (1379)
3/8	1/4	-MTM-M06-H04	1.50 (38.1)	0.09 (2.3)	0.75 (19.1)	20000 (1379)
3/8	3/8	-MTM-M06-H06	1.69 (42.9)	0.13 (3.2)	0.81 (20.6)	20000 (1379)
3/8	9/16	-MTM-M06-H09	1.75 (44.5)	0.19 (4.8)	1.19 (30.2)	20000 (1379)
9/16	1/4	-MTM-M09-H04	1.81 (46.0)	0.09 (2.3)	1.00 (25.4)	20000 (1379)
9/16	3/8	-MTM-M09-H06	2.13 (54.0)	0.13 (3.2)	1.00 (25.4)	20000 (1379)
9/16	9/16	-MTM-M09-H09	2.13 (54.0)	0.19 (4.8)	1.19 (30.2)	20000 (1379)
3/4	1/4	-MTM-M12-H04	2.25 (57.2)	0.09 (2.3)	1.38 (34.9)	20000 (1379)
3/4	3/8	-MTM-M12-H06	2.50 (63.5)	0.13 (3.2)	1.38 (34.9)	20000 (1379)
3/4	9/16	-MTM-M12-H09	2.50 (63.5)	0.19 (4.8)	1.38 (34.9)	20000 (1379)
1	1/4	-MTM-M16-H04	2.94 (74.6)	0.09 (2.3)	1.75 (44.5)	20000 (1379)
1	3/8	-MTM-M16-H06	3.13 (79.4)	0.13 (3.2)	1.75 (44.5)	20000 (1379)
1	9/16	-MTM-M16-H09	3.19 (81.0)	0.19 (4.8)	1.75 (44.5)	20000 (1379)